


Bravo 21 & Bravo 25 Bails

Damaged Bails on the Control Panel

With a growing number of lawnmowers in use, we have noticed an increase in the sales of BAILS.

A typical reason to replace the bail is that it is broken on the right side.

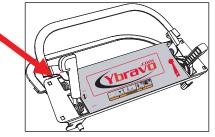


The primary reasons for the damage appears to be from pushing the upper bail forward - using it as a handlebar when moving the mower or possibly even as a "tie down" point.

The pictures illustrate the typical result from forcing and **bending** the bail forward. The left side of the control panel becomes pushed down (dented) and the right side of the bail will develop a crack and later break.

We do not consider this type of damage to be warranty!

 


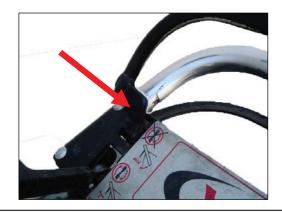

To repair the upper bail there are two options:

1. Replace the Bail Part Number 201010-1

List price: \$9.50



2. Replace the complete Control Panel assembly

Zone Start Mowers
Control Panel Compl. 201178-1



Part Number 201178-1. List Price: \$ 20.00

Bravo 21 and Bravo 25 BBC

Control Panel Compl. 201179-1



Part Number 201179-1. List Price: \$30.00.